View NSN Online: https://aerobasegroup.kr/nsn/8010-00-598-7214

FARWEST PAINT MANUFACTURING CO -- QUICK DRY GLOSS ENAMEL COLOR: #17886 WHITE -- 8010-00-598-7214

============= Product Identification ===============

Product ID:QUICK DRY GLOSS ENAMEL COLOR: #17886 WHITE

MSDS Date:06/01/1993

FSC:8010

NIIN:00-598-7214 Status Code:A

MSDS Number: CLPTK === Responsible Party ===

Company Name: FARWEST PAINT MANUFACTURING CO

Address:4522 SOUTH 133RD ST

City:TUKWILA

State:WA ZIP:98168

Coun try:US

Info Phone Num: 206-244-8844

Emergency Phone Num:800-424-9300 Preparer's Name:ERNEST CARTER Chemtrec Ind/Phone:(800)424-9300

CAGE:6F266

=== Contractor Identification ===

Company Name: FARWEST PAINT MANUFACTURING CO

Address:4522 SOUTH 133RD ST

Box:City:TUKWILA

State:WA ZIP:98168 Country:US

Phone:206-244-8844

CAGE:6F266

======= Composition/Information on Ingredients ========

Ingred Name: MINERAL SPIRITS

CAS:8052-41-3

Code:F

RTECS #:WJ8925000

= Wt:39.

OSHA PEL:2900 MG/M3;500 PPM

ACGIH TLV:525 MG/M3;100 PPM
========== Hazards Identification ============
Routes of Entry: Inhalation:YES Skin:YES Ingestion:YES Reports of Carcinogenicity:NTP:NO IARC:NO OSHA:NO Explanation of Carcinogenicity:THIS PRODUCT CONTAINS NO KNOWN CARCINOGENS IN REPORTABLE QUANTITIES AS DEFINED BY ACGIH, OSHA, NTP, IARC. Effects of Overexposure:SKIN: THIS MATERIAL MAY CAUSE
IRRITATION.SENSITIZATION, OR DEFATTING OF SKIN UPON PROLONGED OR REPEAETD CONTACT. I
NHALATION: EXCESSIVE EXPOSURE TO VAPORS OR SPRAY MIST CAN RESULT IN HEADACHE, DIZZINES S, NAUSEA AND LOSS OF CONSCIOUSNESS.SOME REPORTS HAVE ASSOCIATED REPEAETD & PROLONGED OCCUPATIONAL OVEREXPOSURE TO SOLVENTS WITH PREMAENNT BRAIN & NERVOUS SYSTEM DAMAGE. EYES: THIS MATERIAL MAY BE AN EYE IRRITANT.
======================================
First Aid:SKIN: WASH WITH SOAP AND WATER.REMOVE AND WASH ANY CONTAMINATED CLOTHING BEFORE REUSE. EYES: FLU SH WITH LARGE
QUANTITIES OF WATER FOR 15 MINUTES AND SEEK MEDICAL ATTENTION.SWALLOWING: IF INGESTED DO NOT INDUCE VOMITING; KEEP PERSON WARM AND QUIET AND GET MEDICAL ATTENTION. INHALATION: REMOVE VICTIM TO FRESH AIR IMMEDIATELY. IF RESPIRATORY SYMPTOMS DEVELOP, SEEK MEDICAL ATTENTION AT ONCE.
======================================
Flash Point:=41.7C, 107.F Lower Limits:0.7%

Extinguishing Media:FOAM, CO2, DRY CHEMICAL, OR WATER FOG.


Fire Fight

ing Procedures:FIREFIGHTERS AND OTHERS EXPOSED TO VAPORS OR PRODUCTS OF COMBUSTION SHOULD WEAR SELF CONTAINED BREATHING APPARATUS. EVACUATE AREA OF UNPROTECTED PERSONNEL.WEAR PROTECTIVE CLOTHING.

Unusual Fire/Explosion Hazard: VAPORS MAY FORM AN EXPLOSIVE MIXTURE IN AIR AND MAY BE IGNITED BY SPARKS, PILOT LIGHTS, ETC. CLOSED CONTAINERS MAY RUPTURE WHEN EXPOSED TO EXTREME HEAT.

========= Accidental Release Measures =============

Spill Release Procedures: REM

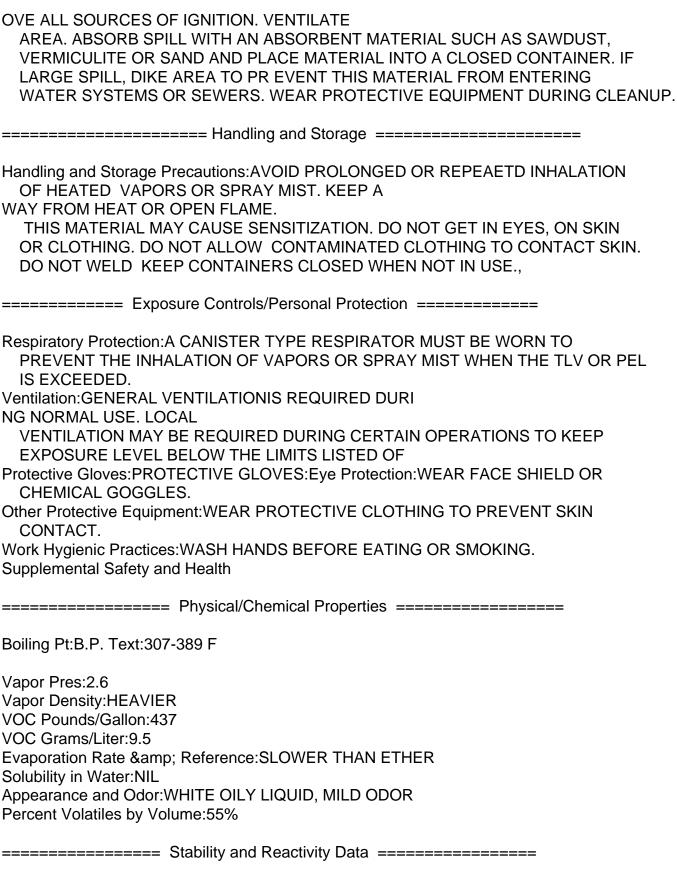

Stability Indicator/Materials to Avoid:YES

AVOID CONTACT WITH STRONG OXIDANTS, ACIDS, BASES AND EPOXY HARDENERS UNDER UNCONTROLLED CONDITIONS.

Stability Condition to Avoid: HEAT, SPARKS AND O

PEN FLAME.

Hazardous Decomposition Products: COMBUSTION CAN YIELD CARBON MONOXIDE AND TOXIC VAPORS.

Conditions to Avoid Polymerization: WILL NOT OCCUR.

======= Disposal Considerations ===========

Waste Disposal Methods:DISPOSAL OF THIS MATERIAL OR ITS CONTAINERS REQUIRES COMPLIANCE WITH APPLICABLE LABELING, PACKAGING AND RECORDKEEPING STANDARDS.

Disclaimer (provided with this information by the compiling agencies): This information is formulated for use by elements of the Department

of Defense. The United States of America in no manner whatsoever, expressly or implied, warrants this information to be accurate and disclaims all liability for its use. Any person utilizing this document should seek competent professional advice to verify and assume responsibility for the suitability of this information to their particular situation.